




REVOLUTION

HELICOPTER CORP., INC.

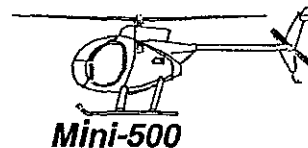

1905 W. Jesse James Rd. • Excelsior Springs, Missouri 64024
Phone (816) 637-2800 • Fax (816) 637-7936

October 2, 1995

Service information letter #100295

Subject: Throttle cables

We have discovered that some of the throttle and oil injector cables were made to the wrong length. Use the following instructions and the included prints to determine if you have the correct cables. If you have the wrong cables, you may either fix them as described below, or send them back and we will cut them to the correct length and return them to you at no charge. You will be responsible for shipping charges.

1. Measure each cable, (#BA31, #BA32, #BA33), from the conduit ferrule to the junction block fitting. This measurement must match the dimension called for on the corresponding print.
NOTE: Pull the cable through the conduit to the stop before measuring.
2. If the cable is too long, simply de-solder the junction block fitting, cut the cable to the proper length and solder the junction block fitting back on.
3. If the cable is too short, simply pull the conduit ferrule off of the plastic conduit, cut the plastic conduit back to the proper length, and push the ferrule back onto the conduit.

NOTE: you must insure that the junction block fitting is soldered back on securely.

If you have any questions please contact Brian Thomas at (816) 637-2800.